

Work Order ID 163571-1

163571

Page 1

Thursday, June 29, 2017 3:57:50 PM

Item ID: D119-646-313

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Skidtube Protector, LH

Start Date: 7/17/2017 Start Qty: 3.00

3

Cust Item ID:

Required Date: 7/19/2017 Req'd Qty: 3.00

3

Customer:

Reference:

Approvals: Process Plan:

Date: JUN 29 2017

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
DSI9734	B								
100	Document Control	0.00							
100	DOCUMENT CONTROL								
DC	Memo	0.00							
Doc.Control -USB or Paperwork									
	Photocopy bluefile & type labels per PPP D119-646-313 CHG002								
110	Pick Kit	0.00							
110									
Packaging	Memo	0.00							
Packaging									
120	QC- 100% Inspect kits for completeness	0.00							
120									
QC	Memo	0.09							
Quality Control									

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
307 10/10/10		307 10/10/10		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 163571

Thursday, June 29, 2017 3:57:50 PM

163571

Page 2

Item ID: D119-646-313

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Skidtube Protector, LH

Start Date: 7/17/2017 Start Qty: 3.00

3

Cust Item ID:

Required Date: 7/19/2017 Req'd Qty: 3.00

3

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130

130

Packaging

Packaging

Packaging

Memo

Identify and pack for shipping as per PPP D119-646-313

Location: **Fg128B.**

0.00

0.00

B2**DAS
28
9-89****JUL 17 2017**

140

140

QC

Quality Control

QC21- Final Inspection - Work Order Release

Memo

0.00

0.30

**DAS
21
9-89****JUL 17 2017****JUL 17 2017**

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Thursday, June 29, 2017 3:57:49 PM

Page 1

Work Order ID: 163571

163571

Parent Item: D119-646-313

D119-646-313

Parent Item Name: Skidtube Protector, LH

Start Date: 7/17/2017

Required Date: 7/19/2017

Start Qty: 3.00

Required Qty: 3.00

Comments: IPP REV:A 15.12.10 NEW ISSUE DD VERF:JLM
17.05.10 AS PER DSI9734 REV B DD VERF:JFS

IPP REV:B

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D3904-1 Washer		Manufactured	No			110	Each	52.0000	6	18		JUL 12 2017	DAS 27 9-89
DAS 28 9-89 ** DAS 27 9-89													
Location FP001 141452 152159 Loc Qty 52 32 20 Loc Code 													

D4506-3 Washer		Manufactured	No			110	Each	24.0000	6	18		JUL 12 2017	DAS 27 9-89
DAS 28 9-89 ** DAS 27 9-89													
Location ST107 157943 Loc Qty 24 24 Loc Code 													

D5369-1 Cable Guard		Manufactured	No			110	Each	0.0000	1	3		JUL 17 2017	DAS 27 9-89
DAS 28 9-89 ** DAS 27 9-89													
D5371-1 Hook		Manufactured	No			110	Each	0.0000	1	3			DAS 27 9-89
DAS 28 9-89 ** DAS 27 9-89													
D5372-1 Plug		Manufactured	No			110	Each	4.0000	1	3		JUL 12 2017	DAS 27 9-89
DAS 28 9-89 ** DAS 27 9-89													

Location ST166 157942	Loc Qty 4 4	Loc Code
------------------------------------	--------------------------	-----------------

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
5795 577 711 5795 577 711								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
								45	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : _____									

Picklist Print

Thursday, June 29, 2017 3:57:49 PM

Page 2

Work Order ID: 163571

163571

Parent Item: D119-646-313

D119-646-313

Parent Item Name: Skidtube Protector, LH

Start Date: 7/17/2017

Required Date: 7/19/2017

Start Qty: 3.00

Required Qty: 3.00

D5374-1 Manufactured No 110 Each 15.0000 6 18

D5374-1

Bushing

DAS
28
9-89

Location

Loc Qty

Loc Code

ST166

15

157941

15

**

JUL 12 2017

3 x 16358

95

DAS
6
9-89

DAS
27
9-89

D5374-3 Manufactured No 110 Each 10.0000 8 24

D5374-3

Bushing

DAS
28
9-89

Location

Loc Qty

Loc Code

prelim

8

139857

8

ST166

2

157944

2

**

JUL 12 2017

163588x16

2

DAS
6
9-89

DAS
27
9-89

D5376-1 Manufactured No 110 Each 5.0000 1 3

D5376-1

Drilling Tool

DAS
28
9-89

Location

Loc Qty

Loc Code

ST365

5

157940

5

**

JUL 12 2017

2

DAS
6
9-89

DAS
27
9-89

AN3-47A Purchased No 110 Each 16.0000 6 18

AN3-47A

Bolt

DAS
28
9-89

Location

Loc Qty

Loc Code

ST346

16

m137075

16

**

JUL 12 2017

2 x 138003

16

DAS
6
9-89

DAS
27
9-89

Thursday, June 29, 2017 3:57:49 PM

Shop Packet Print

Page 2

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step # : _____		QTY Effective : _____			MRB (QSI042) Approval _____		
Description Work Order Deviation				Disposition				Completed By _____	
								Lead hand / Supervisor Approval Verification _____	
								QC / QA Coordinator Approval _____	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Thursday, June 29, 2017 3:57:49 PM

Page 4

Work Order ID: 163571

163571

Parent Item: D119-646-313

D119-646-313

Parent Item Name: Skidtube Protector, LH

Start Date: 7/17/2017

Required Date: 7/19/2017

Start Qty: 3.00

Required Qty: 3.00

MS21042L3

Purchased

No

110

Each

1,447.000

10

30

MS21042L3

Nut

**

JUL 12 2017

DAS
6
9-89

DAS
27
9-89

DAS
28
9-89

Location

Loc Qty

Loc Code

FP001

79

m135945

79

GA

394

m134360

102

M136665

292

OVER007

500

m134360

0

m137886

500

ST303

474

m137680

474

30 20

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																							
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																												
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																												
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																												
Large Fab ☐	Composite ☐	Supplier ☐																																																													
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval																																																								
Description Work Order Deviation				Disposition				Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	No Re-verification ☐	Operator ☐	Offset/Setup ☐	Supplier ☐	Training ☐	Use for Testing ☐	Poor Information ☐	Rushing ☐	Product Improvement ☐	Process Improvement ☐	Manufacturing Process ☐	Past Due ☐	Pressure/Forced ☐	Bending ☐	Centre Not Concentric ☐	Cracks ☐	Crimp/Kink/Ripple/Wave ☐	Cuffs ☐	Crushing ☐	Heat Treat ☐	Wave/Twist in Tube ☐	Marks/Chatter ☐	Temperature/Cure ☐	Set-up ☐	BOM/Route ☐	Broken/Damage/Defect ☐	Inspection Incomplete/Unqualified ☐	Contamination ☐	Countersink ☐	Cut Too Short ☐	Instructions Incomplete/Unclear ☐	Drill Holes ☐	Power Loss/Surge ☐	Folio/Program ☐	Grain ☐	Weld ☐	Wrong Stock Pulled ☐	Out of Sequence ☐	Off-set ☐	Mislabeled ☐	Fit/Function ☐	Misaligned/off center ☐	Positioned Wrong ☐	Outside Dimensions ☐	Over/Under tolerance ☐	Part Incorrect ☐	Part Lost/Missing ☐	Part Moved ☐	Drawing ☐	Finish ☐	Misread ☐	Turning Sequence ☐
																						OTHER : _____																																									

DART SERVICE INSTRUCTION

TO AMEND INSTALLATION INSTRUCTIONS IIN-D119-646 REV. D
AND INSTRUCTIONS FOR CONTINUED AIRWORTHINESS ICA-D119-646 REV. 3
REF FAA STC: SR02024SE
REF EASA STC: 10040294

1.0 PURPOSE:

The purpose of this Dart Service Instructions is to add D119-646-313/-314 Skidtube Protector Kit to make the D119-646-011/-012/-041/-111/-112/-141/-211/-212/-241 Skidtube Kits compatible with the 109-0812-68-105 Hoist Structural Provision Kit and the 109-0816-18-301 Rappelling Kit. The D119-646-313 Skidtube Protector, LH replaces the 109-B710-05-201 kit and the D119-646-314 Skidtube Protector, RH replaces the 109-B710-05-202 kit.

B 2.0 D119-646-011/-012/-041/-111/-112/-141 MODIFICATION:

The following instructions are for modifying the D119-646-011/-012/-041/-111/-112/-141 Skidtube at CHG 004 and prior, to allow for D119-646-313/-314 Skidtube Protector Kit installation:

- 2.1 Remove D3492-045 Plug Assemblies from two locations on each side of the skidtube as shown in Figure 3.
- 2.2 Position D5376-1 drilling jig tool with the arrow pointing fwd as shown in Figure 3. Use 2x AN3-45A bolts to hold the jig in place. Transfer drill 4x $\varnothing 0.129$ " (#30 drill) holes from D5376-1 drilling jig to skidtube ridge as shown in Figure 3. **Caution:** Drill perpendicular to the skidtube ridge.
- 2.3 Remove drilling jig. Using a 5/16" drill, open up the pilot holes and drill through the skidtube ridge and center web inside of the skidtube. **Caution:** Drill perpendicular to the skidtube ridge.
- 2.4 Countersink 4x 5/16" holes to $\varnothing 0.348$ " (8.84mm) x 100° as shown in Figure 3 and deburr.
- 2.5 Repeat steps 2.2 to 2.4 for the opposite side of the skidtube.
- 2.6 Vacuum the debris from inside of the skidtube. Touch up affected area using (Alodine 1200 or 1201) per MIL-DTL-5541.
- 2.7 Install 8x D5374-3 Bushings in the new holes. Seal bushings with Sikaflex-241/-291 or Proseal 890 or MIL-S-8802 Class 'B2' sealant as shown in Section C-C.

D119-646-011/-012/-041/-111/-112/-141 Skidtube at CHG 005 and subsequent, do not require modification. Discard D5376-1 Drilling jig and D5374-3 Bushings.

B 3.0 D119-646-211/-212/-241 MODIFICATION:

The following instructions are for modifying the D119-646-211/-212 Skidtube at CHG 005 and prior, and D119-646-241 at CHG 004 and prior, to allow for D119-646-313/-314 Skidtube Protector Kit installation:

- 3.1 Temporarily remove D3849-043 Training Wearplate from aft end of the skidtube per ICA-D119-646 Section 32.
- 3.2 Position D5376-1 drilling jig tool with the arrow pointing fwd as shown in Figure 3. Use 2x AN3-45A bolts to hold the jig in place. Transfer drill 4x $\varnothing 0.129$ " (#30 drill) holes from D5376-1 drilling jig to skidtube ridge as shown in Figure 3. **Caution:** Drill perpendicular to the skidtube ridge.
- 3.3 Remove drilling jig. Using a 5/16" drill, open up the pilot holes and drill through the skidtube ridge and center web inside of the skidtube. **Caution:** Drill perpendicular to the skidtube ridge.
- 3.4 Countersink 4x 5/16" holes to $\varnothing 0.348$ " (8.84mm) x 100° as shown in Figure 3 and deburr.
- 3.5 Repeat steps 3.2 to 3.4 for the opposite side of the skidtube.
- 3.6 Vacuum the debris from inside of the skidtube. Touch up affected area using (Alodine 1200 or 1201) per MIL-DTL-5541.
- 3.7 Install 8x D5374-3 Bushings in the new holes. Seal bushings with Sikaflex-241/-291 or Proseal 890 or MIL-S-8802 Class 'B2' sealant as shown in Section C-C.

D119-646-211/-212 Skidtube at CHG 006 and subsequent, and D119-646-241 Skidtube at CHG 005 and subsequent, do not require modification. Discard D5376-1 Drilling jig and D5374-3 Bushings.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 163871

JUN 29 2017

APPROVED

B	REVISED DSI TO INCLUDE INSTALLATION INSTRUCTIONS FOR SKIDTUBE ASSY D119-646-011/-012/-111/-112/-041/-141/-241 CHG 005 & SUBSEQUENT AND SKIDTUBE ASSY D119-646-211/-212 CHG 006 & SUBSEQUENT. ADDED NAS1149D0316J WASHERS TO BOM.		WK	17.02.16
A	NEW ISSUE		RF	15.12.10
REV.	DESCRIPTION		BY	DATE
DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR		
DRAWN	WK			
CHECKED	VS	DRAWING NO.	REV. B	
MFG. APPR.	N/A	DSI 9734	SHEET 1 OF 10	
APPROVED	MS	TITLE	SCALE	
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS	
DATE	17.02.16		COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

B 4.0 INSTALLATION OF D119-646-313/-314 ONTO D119-646-011/-012/-041/-111/-112/-141:

- 4.1 Remove all D3492-045 Plug Assemblies from skidtube fwd of the ground handling wheel lugs.
- 4.2 For installation of the D119-646-313/-314 Skidtube Protector Kit onto the D119-646-011/-012/-041/-111/-112/-141 Skidtube at CHG 005 and subsequent, Install NAS1149D0316J and NAS1149D0332J washers as shown in Detail G, Figure 6.
- 4.3 If the D119-646-314 Skidtube Protector Kit is required for hoisting operations on the RH side of the aircraft install D5372-1 Plug using 4x AN3-45A bolts, 8x NAS1149D0332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 4 Detail E. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 4.4 If the D119-646-313 Skidtube Protector Kit is required for hoisting operations on the LH side of the aircraft install D5372-1 Plug using 4x AN3-45A bolts, 8x NAS1149D0332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 4 Detail E. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 4.5 If the D119-646-314 Skidtube Protector Kit is required for rappelling operations on the RH side of the aircraft install D5371-2 Hook using 4x AN3-45A bolts, 8x NAS1149D0332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 5 Detail F. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 4.6 If the D119-646-313 Skidtube Protector Kit is required for rappelling operations on the LH side of the aircraft install D5371-1 Hook using 4x AN3-45A bolts, 8x NAS1149D0332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 5 Detail F. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 4.7 Install D5369-2 Cable Guard on the RH side of the aircraft using 6x AN3-47A bolts, 6x D5374-1 Bushings, 6x D4506-3 Washers, 12x NAS1149D0332J washers, 6x MS21042L3 nuts as shown in Figure 1 Section A-A. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 4.8 Install D5369-1 Cable Guard on the LH side of the aircraft using 6x AN3-47A bolts, 6x D5374-1 Bushings, 6x D4506-3 Washers, 12x NAS1149D0332J washers, 6x MS21042L3 nuts as shown in Figure 1 Section A-A. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 4.9 Update aircraft log book to indicate installation of the D119-646-313/-314 kit and adjust weight and balance record for the aircraft with weight and balance data provided in Section 7.0 of this document.

NOTE: Additional NAS1149D0332J washers may be installed under the nuts to ensure 1.5 - 4 threads in safety on the bolts. Although not generally necessary, it is also acceptable to replace the AN3 bolts provided with longer or shorter AN3 bolts, if required.

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	VS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9734	SHEET 2 OF 10
APPROVED	VS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS
DATE	17.02.16	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

B 5.0 INSTALLATION OF D119-646-313/-314 ONTO D119-646-211/-212/-241:

- 5.1 Remove and discard all hardware attaching the training wearplates in front of the skidtube ground handling lugs.
- 5.2 For installation of the D119-646-313/-314 Skidtube Protector Kit onto the D119-646-211/-212 Skidtube at CHG 006 and subsequent, and D119-646-241 Skidtube at CHG 005 and subsequent, remove all D3492-045 Plug Assemblies from skidtube fwd of the ground handling wheel lugs & install NAS1149D0316J and NAS1149D0332J washers as shown in Detail G, Figure 6.
- 5.3 If the D119-646-314 Skidtube Protector Kit is required for hoisting operations on the RH side of the aircraft install D5372-1 Plug using 4x AN3-45A bolts, 8x NAS1149D0332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 4 Detail E. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 5.4 If the D119-646-313 Skidtube Protector Kit is required for hoisting operations on the LH side of the aircraft install D5372-1 Plug using 4x AN3-45A bolts, 8x NAS1149D0332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 4 Detail E. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 5.5 If the D119-646-314 Skidtube Protector Kit is required for rappelling operations on the RH side of the aircraft install D5371-2 Hook using 4x AN3-45A bolts, 8x NAS1149D0332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 5 Detail F. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 5.6 If the D119-646-313 Skidtube Protector Kit is required for rappelling operation on the LH side of the aircraft install D5371-1 Hook using 4x AN3-45A bolts, 8x NAS1149D0332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 5 Detail F. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 5.7 Reinstall the D3849-043 Training Wearplate on the aft end of the skidtube per ICA-D119-646 Section 32, except for hardware under D5369-1/-2 Cable Guard.
- 5.8 Install D5369-2 Cable Guard on the RH side of the aircraft using 6x AN3-50A bolts, 6x D5374-1 Bushings, 6x D3904-1 Washers, 6x MS21042L3 nuts as shown in Figure 2 Section B-B. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 5.9 Install D5369-1 Cable Guard on the LH side of the aircraft using 6x AN3-50A bolts, 6x D5374-1 Bushings, 6x D3904-1 Washers, 6x MS21042L3 nuts as shown in Figure 2 Section B-B. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 5.10 Update aircraft log book to indicate installation of the D119-646-313/-314 kit and adjust weight and balance record for the aircraft with weight and balance data provided in Section 7.0 of this document.

NOTE: Additional NAS1149D0332J washers may be installed under the nuts to ensure 1.5 - 4 threads in safety on the bolts. Although not generally necessary, it is also acceptable to replace the AN3 bolts provided with longer or shorter AN3 bolts, if required.

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	WK		
CHECKED	VS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9734	SHEET 3 OF 10
APPROVED	VS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS
DATE	17.02.16	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

6.0 PARTS LIST:

Qty. -313	Qty. -314	PART NUMBER	DESCRIPTION
X		D119-646-313	SKIDTUBE PROTECTOR, LH
	X	D119-646-314	SKIDTUBE PROTECTOR, RH
6	6	D3904-1	WASHER
6	6	D4506-3	WASHER
1		D5369-1	CABLE GUARD, LH
	1	D5369-2	CABLE GUARD, RH
1		D5371-1	HOOK, LH
	1	D5371-2	HOOK, RH
1	1	D5372-1	PLUG
6	6	D5374-1	BUSHING
8	8	D5374-3	BUSHING
1	1	D5376-1	DRILLING JIG
4	4	AN3-45A	BOLT
6	6	AN3-47A	BOLT
6	6	AN3-50A	BOLT
18	18	NAS1149D0332J	WASHER
4	4	NAS1149D0316J	WASHER
10	10	MS21042L3	NUT

B

7.0 WEIGHT AND BALANCE

The following weight and balance changes are applicable:

Installation	Weight	LONGITUDINAL		LATERAL	
		Arm	Moment	Arm	Moment
D119-646-313 SKIDTUBE PROTECTOR, LH	4.3 lb 1.95 kg	108.1 in 4.3 m	465 in-lb 8.4 kg-m	-43.4 in 1.7 m	-187 in-lb -3.3 kg-m
D119-646-314 SKIDTUBE PROTECTOR, RH	4.3 lb 1.95 kg	108.1 in 4.30 m	465 in-lb 8.4 kg-m	43.4 in 1.7 m	187 in-lb 3.3 kg-m

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	WK		
CHECKED	VS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9734	SHEET 4 OF 10
APPROVED	VS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS
DATE	17.02.16	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

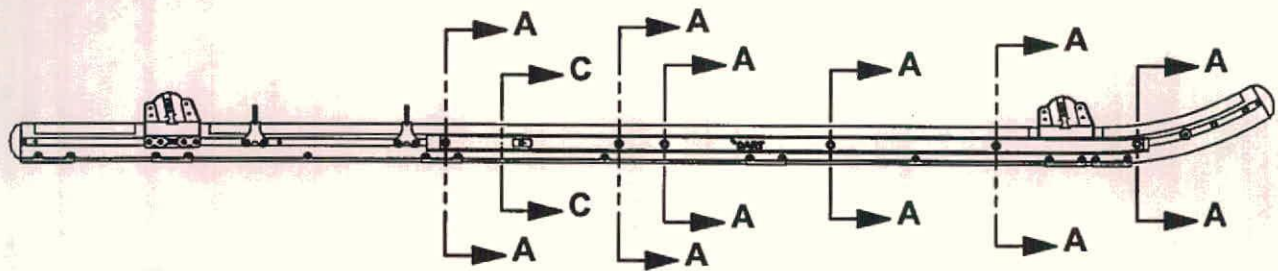


FIGURE 1: D119-646-314 SKIDTUBE PROTECTOR KIT, RH (SHOWN)
 (D119-646-313 SKIDTUBE PROTECTOR, LH (OPPOSITE))
 (SHOWN INSTALLED ON D119-646-011/-012/-111/-112 SKIDTUBES)

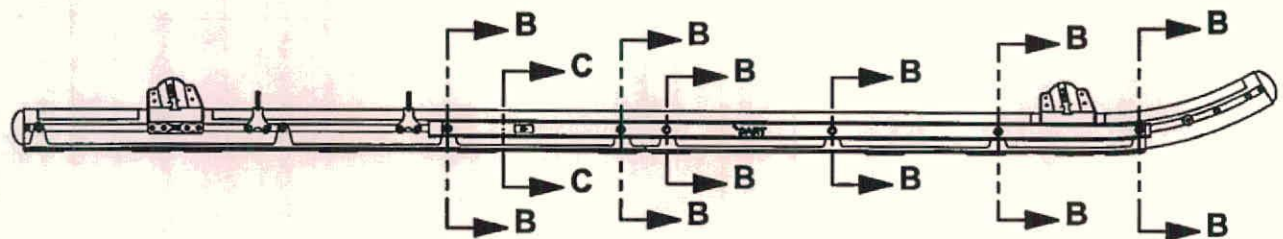


FIGURE 2: D119-646-314 SKIDTUBE PROTECTOR KIT, RH (SHOWN)
 (D119-646-313 SKIDTUBE PROTECTOR, LH (OPPOSITE))
 (SHOWN INSTALLED ON D119-646-211/-212 SKIDTUBES)


APPROVED

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	WK		
CHECKED	VS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9734	SHEET 5 OF 10
APPROVED	VS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS
DATE	17.02.16	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


NOTES:




- 1) D5374-3 BUSHINGS ARE ONLY USED WITH:
 - D119-646-011/-012/-041/-111/-112/-141/-241
 CHG 004 AND PRIOR
 - D119-646-211/-212 CHG 005 AND PRIOR

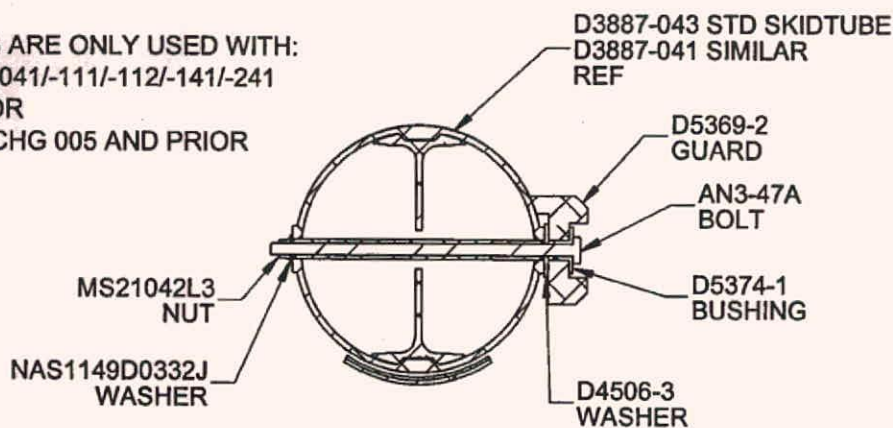

SECTION A-A

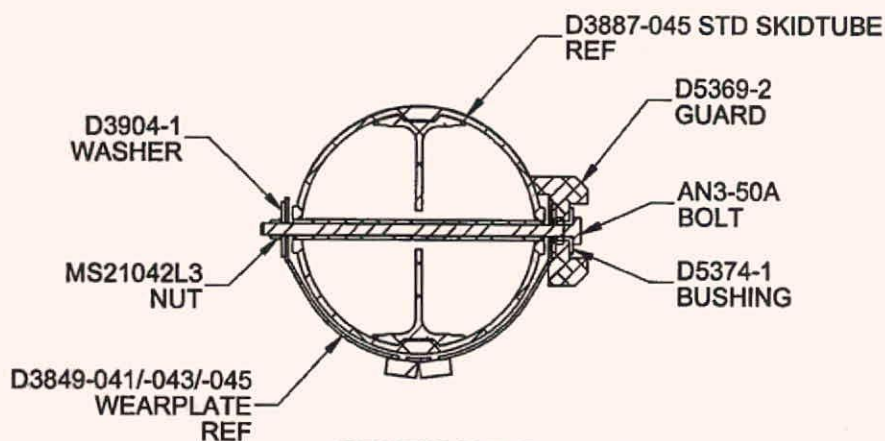

SECTION B-B

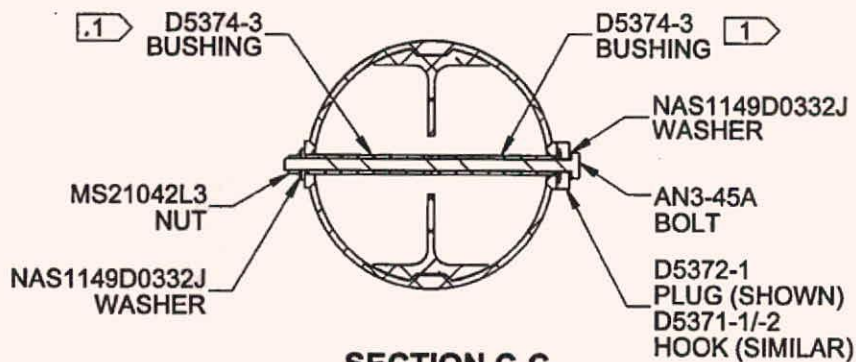


SECTION C-C

(D5369-2 NOT SHOWN FOR CLARITY)

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	WK		
CHECKED	VS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9734	SHEET 6 OF 10
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS
DATE	17.02.16	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

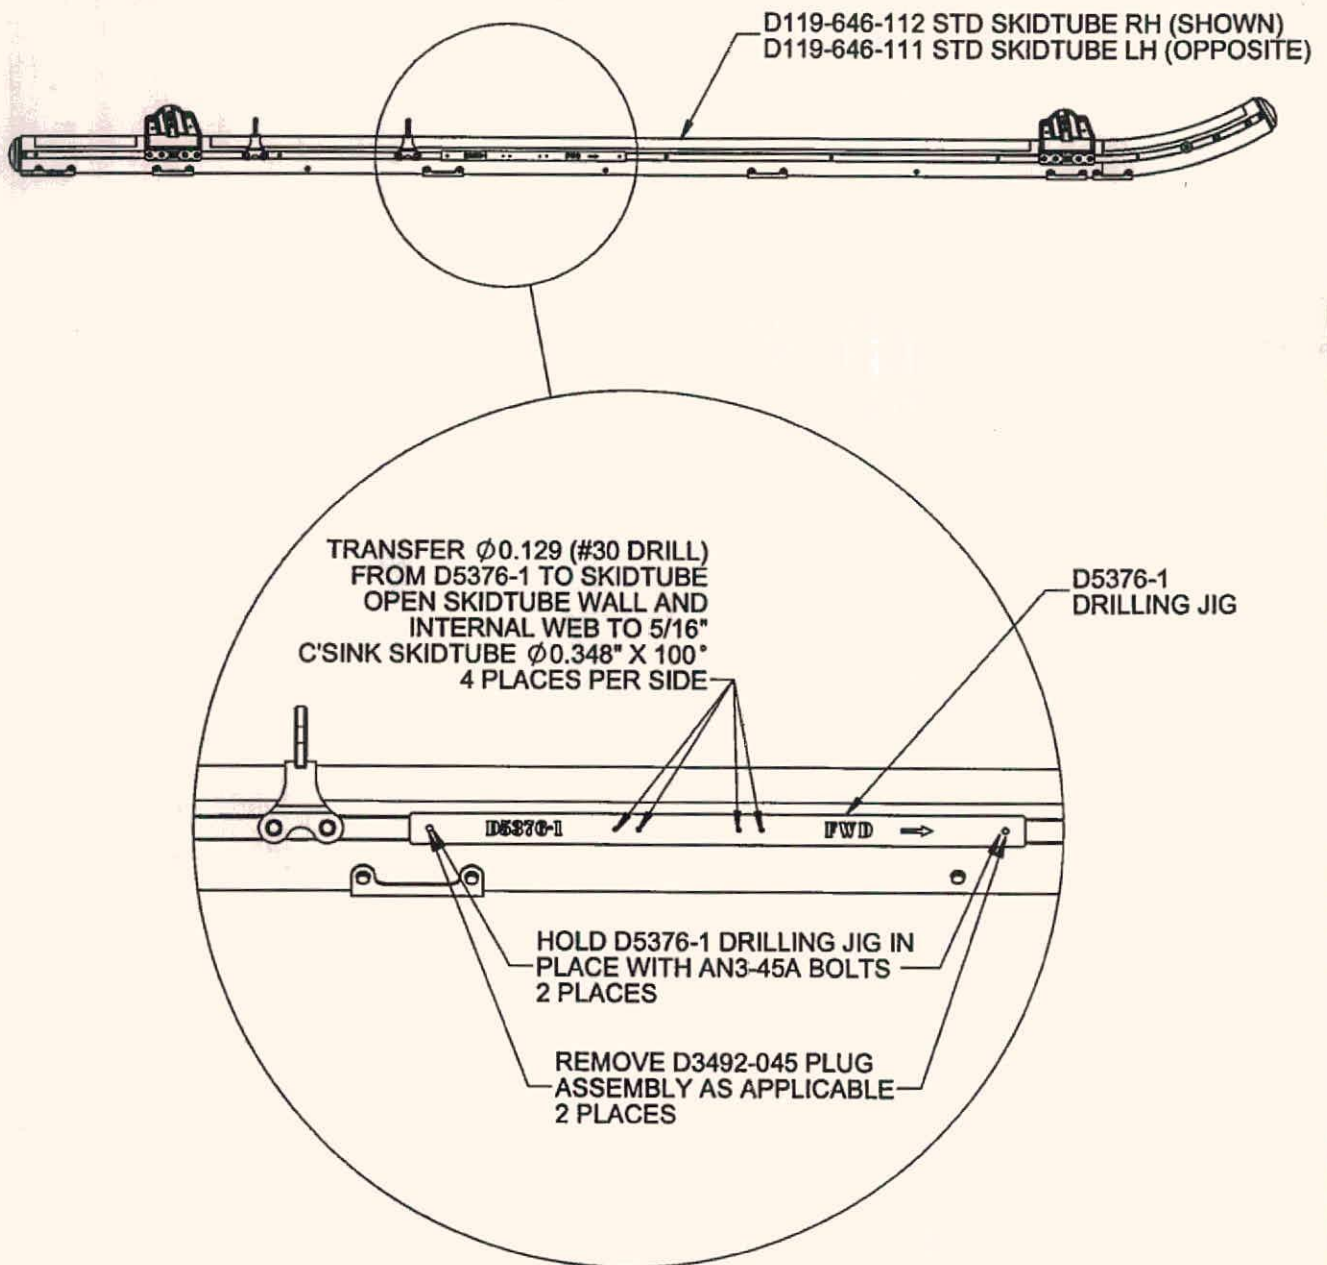

DETAIL D



FIGURE 3: USING D5376-1 DRILLING JIG



D5376-1 DRILLING JIG IS ONLY USED WITH SKIDTUBE ASSEMBLIES:
 - D119-646-011/-012/-041/-111/-112/-141/-241 CHG 004 AND PRIOR
 - D119-646-211/-212 CHG 005 AND PRIOR

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	WK		
CHECKED	VS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9734	SHEET 7 OF 10
APPROVED	VS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS
DATE	17.02.16	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

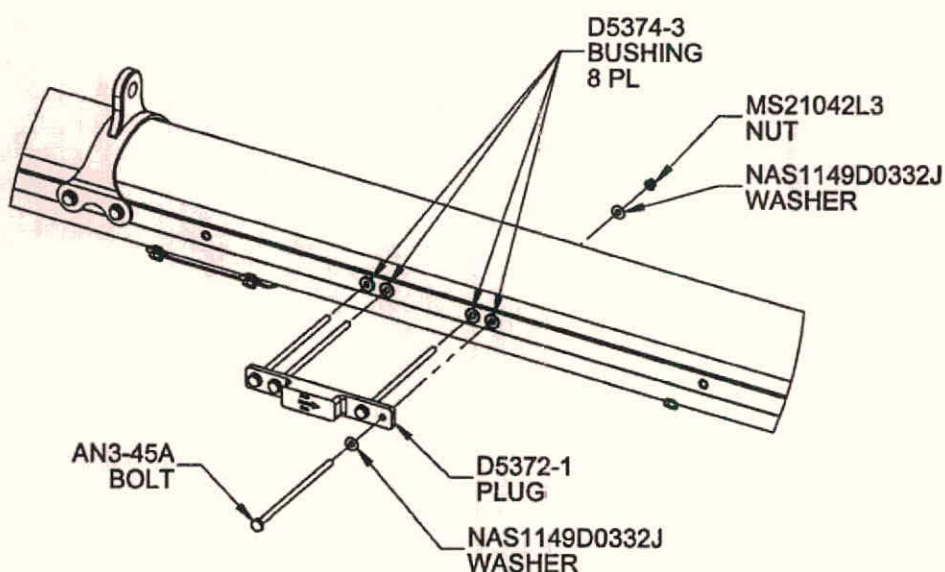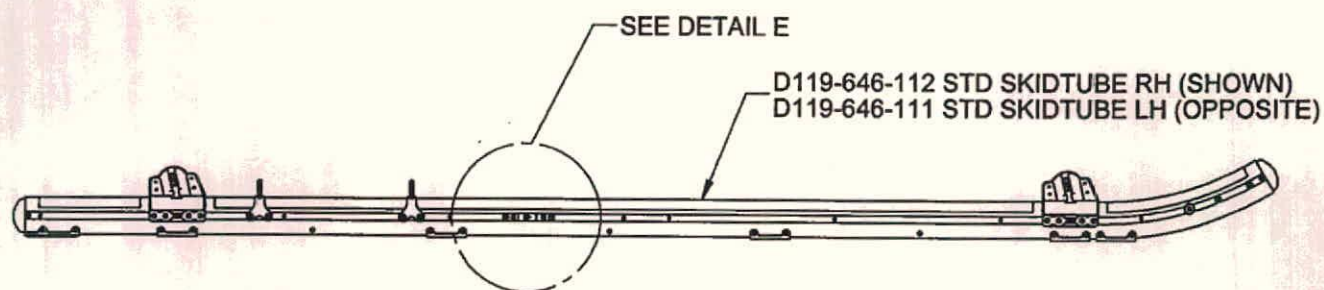

DETAIL E



FIGURE 4: D5372-1 PLUG INSTALLATION



D5374-3 BUSHINGS ARE ONLY USED WITH SKIDTUBE ASSEMBLIES:
 - D119-646-011/-012/-041/-111/-112/-141/-241 CHG 004 AND PRIOR
 - D119-646-211/-212 CHG 005 AND PRIOR

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	WK		
CHECKED	VS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9734	SHEET 8 OF 10
APPROVED	VS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS
DATE	17.02.16	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

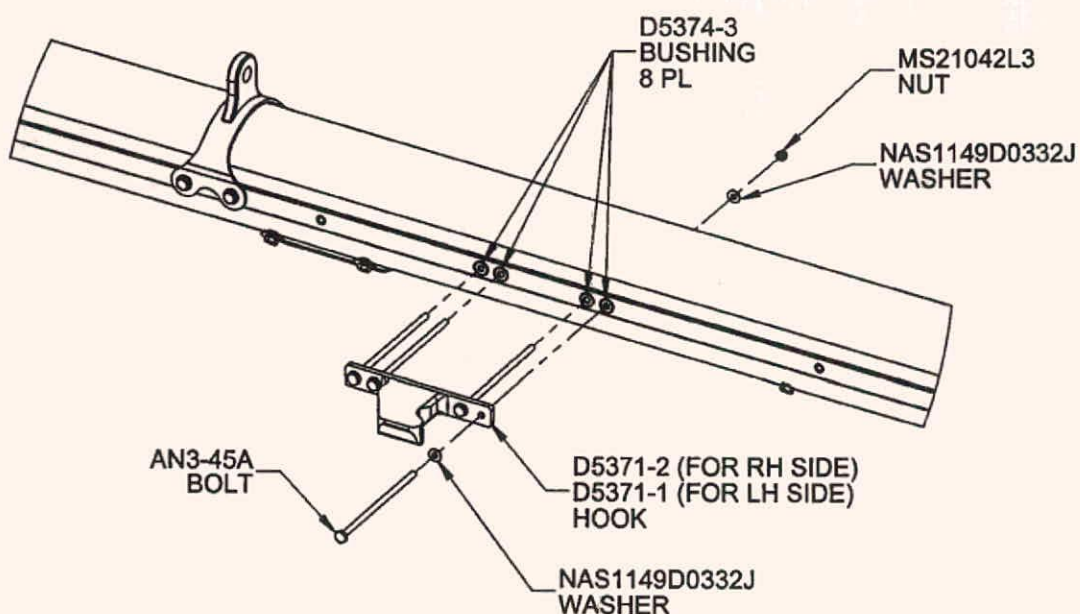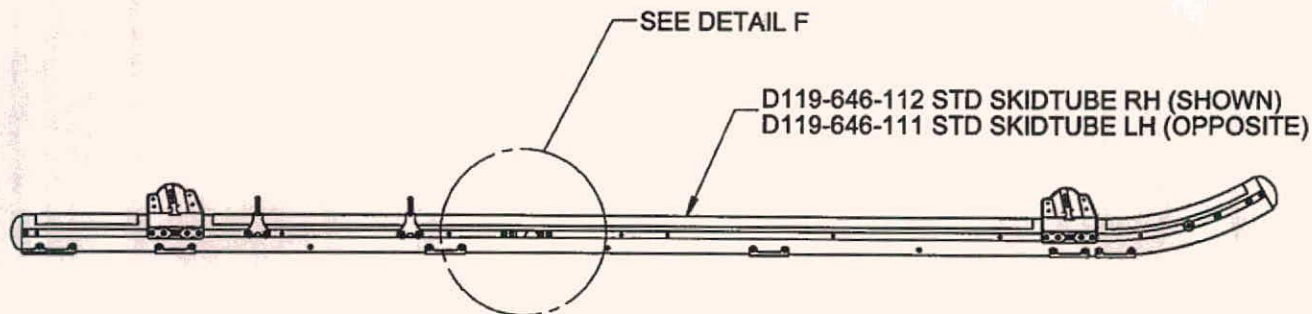

DETAIL F

FIGURE 5: D5371-1/-2 HOOK INSTALLATION





D5374-3 BUSHINGS ARE ONLY USED WITH SKIDTUBE ASSEMBLIES:
- D119-646-011/-012/-041/-111/-112/-141/-241 CHG 004 AND PRIOR
- D119-646-211/-212 CHG 005 AND PRIOR

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	WK		
CHECKED	VS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9734	SHEET 9 OF 10
APPROVED	VS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS
DATE	17.02.16	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

NOTES:

1) D5371-1/2 HOOK ASSEMBLY SHOWN, D5372-1 PLUG ASSEMBLY SIMILAR.

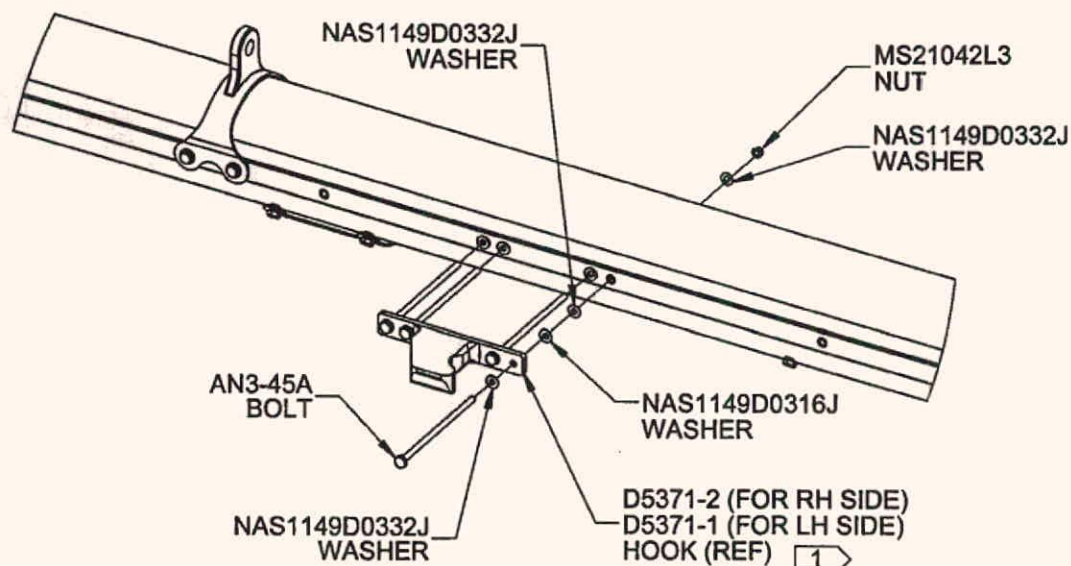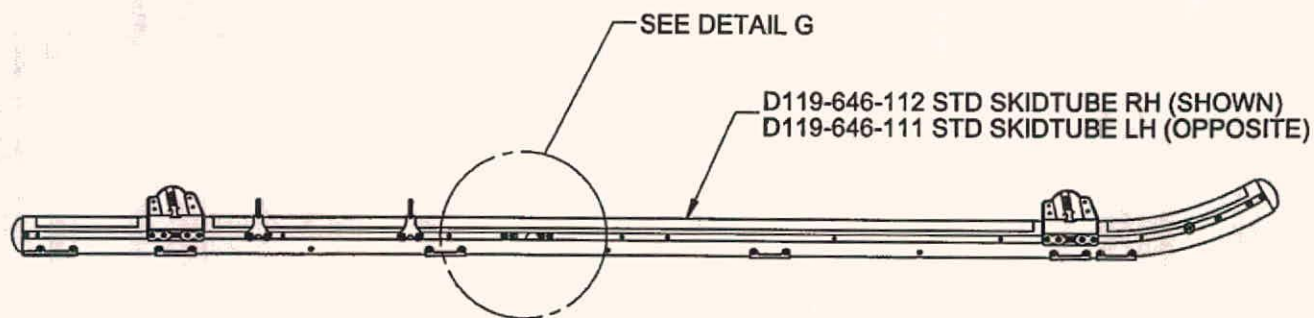

DETAIL G



FIGURE 6: HOOK & PLUG INSTALLATION

NAS1149D0316J and NAS1149D0332J WASHER BUILDUP IS ONLY USED WITH SKIDTUBE ASSEMBLIES:

- D119-646-011/-012/-041/-111/-112/-141/-241 CHG 005 AND SUBSEQUENT
- D119-646-211/-212 CHG 006 AND SUBSEQUENT

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	WK		
CHECKED	VS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9734	SHEET 10 OF 10
APPROVED	VS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS
DATE	17.02.16	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Order Confirmation

Your Web Tracking Number is: **W8979561**

Your order number will be included in your order confirmation e-mail.

Shopping Cart > Shipping > Payment > Review > **Confirmation**

Thank you Chantal Lavoie, your order is complete!



Looking for your orders?

Click here to track.

ORDER STATUS

Message to Warehouse: no message

SHIPPING INFORMATION

Shipping Account Number: 86046019

Ship To Attention:

Chantal

ACCOUNTS PAYABLE

Lavoie

SHIP-TO ADDRESS:

1270 ABERDEEN ST

HAWKESBURY, ON K6A 1K7

CA

You have chosen

Standard Shipping for this order.

PAYMENT INFORMATION

Payment Type: Purchase Order

PO Number: po36895

Charge Code:

ORDER LEVEL ACCOUNTING CODES

Items

[Expand All](#) / [Collapse All](#)

Description	Catalog #	Availability	Unit	Qty	Your Price	Extended Price
☒ POTASSIUM IODIDE RG 100G.	470302-176	Direct from Supplier	EA	2	\$44.65	\$89.30

Availability: - **Shipped directly from ALDON CORP SE,**
If availability is critical, please call VWR at 1-800-932-5000

Warehouse Message no message

Line Item Comments

Line Accounting Data 1

Charges:

Item Subtotal =	\$89.30
Estimated Shipping =	\$27.79
Estimated Hazard =	\$0.00
Estimated Special Services / Handling / Fuel Surcharge =	\$0.00
Estimated GST/HST =	\$15.22
Estimated PST/QST =	\$0.00
Estimated Total =	\$132.31

Work Order ID 163571-1

Thursday, June 29, 2017 3:57:50 PM

163571

Page 1

Item ID: D119-646-313

Revision ID:

Item Name: Skidtube Protector, LH

Start Date: 7/17/2017 Start Qty: 3.00

Required Date: 7/19/2017 Req'd Qty: 3.00

References:

Accept

N900040100

Setup Start *NS1*

Stop *NS2*

Cust Item ID:

Customer:

3

3

Approvals: Process Plan:

Date: JUN 29 2017

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start *NR1*

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

DSI9734

B

DAS

6

9-89

JUL 10 2017

100

Document Control

0.00

100

DC

DOCUMENT CONTROL

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy bluefile & type labels per PPP D119-646-313 CHG002

CB 3 JUL 17 2017

110

Pick Kit

0.00

110

Packaging

Memo

0.00

Packaging

3 DAS 6 9-89 JUL 12 2017

120

QC4- 100% Inspect kits for completeness

0.00

120

QC

Memo

0.09

Quality Control

100

REFERENCE ONLY

6.0 PARTS LIST:

Qty. -313	Qty. -314	PART NUMBER	DESCRIPTION
X		D119-646-313	SKIDTUBE PROTECTOR, LH
	X	D119-646-314	SKIDTUBE PROTECTOR, RH
6	6	D3904-1	WASHER
6	6	D4506-3	WASHER
1		D5369-1	CABLE GUARD, LH
	1	D5369-2	CABLE GUARD, RH
1		D5371-1	HOOK, LH
	1	D5371-2	HOOK, RH
1	1	D5372-1	PLUG
6	6	D5374-1	BUSHING
8	8	D5374-3	BUSHING
1	1	D5376-1	DRILLING JIG
4	4	AN3-45A	BOLT
6	6	AN3-47A	BOLT
6	6	AN3-50A	BOLT
18	18	NAS1149D0332J	WASHER
4	4	NAS1149D0316J	WASHER
10	10	MS21042L3	NUT

B

7.0 WEIGHT AND BALANCE

The following weight and balance changes are applicable:

Installation	Weight	LONGITUDINAL		LATERAL	
		Arm	Moment	Arm	Moment
D119-646-313 SKIDTUBE PROTECTOR, LH	4.3 lb 1.95 kg	108.1 in 4.3 m	465 in-lb 8.4 kg-m	-43.4 in 1.7 m	-187 in-lb -3.3 kg-m
D119-646-314 SKIDTUBE PROTECTOR, RH	4.3 lb 1.95 kg	108.1 in 4.30 m	465 in-lb 8.4 kg-m	43.4 in 1.7 m	187 in-lb 3.3 kg-m

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	VS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9734	SHEET 4 OF 10
APPROVED	VS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE PROTECTOR KIT	NTS
DATE	17.02.16	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

